



Formula #22801

# Labor Saver

## Scrubable Floor Finish

Cera Rayado

- Wet-Look Gloss • Durable
- Detergent Resistant • Easily Repairable



## Technical Data Sheet

### PRODUCT DESCRIPTION:

A high solids, wet gloss finish combines the "repairability" of waxes with the toughness and durability of acrylic polymers.

### USES:

Use on all floors that are not affected by water where a high quality 25% finish is advantageous.

### ADVANTAGES:

High solids of this product allow 2 coats to be equivalent to 3 coats of conventional floor finishes, saving labor and material costs. Black heel mark resistant, scuff resistant, non-yellowing and extremely durable. It dries fast, spray buffs to a high shine and does not powder. Easily restored by spray buffing or burnishing. Maintenance can be accomplished with either low, medium or high speed rotary floor machines.

### SPECIFICATIONS:

Total Solids: 25%  
pH: 9.2  
Color: Off White  
Solubility in Water: Mixes  
Odor: Slight Acrylic  
Flash Point: None  
Viscosity: Thin Liquid  
Weight per Gallon: 8.5 Lbs.

### PRODUCT/CONTAINER

#### DISPOSAL:

Dispose of used/unwanted product according to state and local regulations. Offer container for recycling.

### SIZES AVAILABLE:

1 Gallon Bottle, 5 Gallon Pail,  
30 & 55 Gallon Drums.



### DIRECTIONS FOR PRODUCT USE:

#### INITIAL APPLICATION

1. Remove all old wax and floor finish with appropriate stripper.
  2. Rinse the floor thoroughly (at least twice) with clean water.
  3. Repeat steps 1-2 if all old finish is not removed. Allow floor to dry.
  4. Apply 3-4 thin coats using a clean synthetic mop, allowing a minimum of 30 minutes between coats.
  5. Apply additional coats in same manner, allowing at least 30 minutes drying time between coats.
  6. For very porous floors, an initial coat of floor sealer is recommended.
- NOTE:** Temperature, humidity and air movement affect curing time. To avoid contamination, do not return any used material to original container.

#### ROUTINE MAINTENANCE

1. Sweep or dust mop as necessary.
2. Damp mop with proper cleaner following label instructions. For accumulated soil, lightly scrub as needed.
3. After cleaning, spray buffing or burnishing may also be done once loose dirt and dust has been swept up.
4. Additional coats may be applied if needed.

**FOR PROPER PERFORMANCE USE ONLY WHEN PRODUCT TEMPERATURE AND FLOOR TEMPERATURE ARE 50° F OR HIGHER.**

**WARNING:** Do not allow wet floor areas to be open to foot traffic. Wet shoes or wet spots can create a slippery condition. Wet floor areas should be cordoned off until dry for traffic.


Coverage: 2000-2500 square feet per gallon



It is recommended that protective gloves and safety glasses be worn when using this and all cleaning products. Refer to SDS for further safety information.



FLOOR COATING  
AND FINISHING MATERIAL  
AS TO SLIP RESISTANCE ONLY  
210S

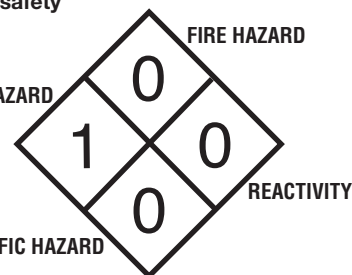

**AMERICAN** Cleaning Solutions  
Division of American Wax Company, Inc.

39-30 Review Avenue  
Long Island City, New York 11101  
1-888 WAX PLUS • (718) 392-8080 Fax: (718) 482-9366  
Visit us on the web! [www.cleaning-solutions.com](http://www.cleaning-solutions.com)

